

Mounting Instructions for Dielectric Treater Sleeves

During the following procedures, keep working area and sleeve surface as clean as possible. Avoid damage of sleeve surface when using tools.

1. Place roll in vertical position on the floor or bench.
2. Slip the open end of the sleeve over the upper end of the roll by approx. 50-75mm.
3. Introduce the nozzle of a high pressure air line between the sleeve and the roll.
4. Hold sleeve firmly with both hands while air valve is slowly opened by an assistant.
5. While sleeve fills with air, it will expand and can be pulled all the way down over the entire length of the roll.
6. Make sure that the sleeve projects over the roll face on both ends by at least 25mm.

Note: When sleeves are ordered for replacement, please specify total length at least 100mm longer, to allow for contraction and overlap.

